

# 5-phase Stepping Motor Driver GDB-5411A-00 Instructions Manual (For designers' use)

Please ensure to read and understand this Instructions Manual before using the product. Please keep this Instructions Manual at hand so that it is always available for reference.

PR0819-2

#### Instructions Manual

#### Introduction

This Instructions Manual describes the safe and proper method of handing "5-phase Stepping Motor Driver GDB-5411A-00" with emphasis on the specifications, assuming that our readers are engaged in designing of control devices incorporating stepping motors. Please ensure to read and understand this Instructions Manual before using the product.

Please keep this Instructions Manual at hand

so that it is always available for reference.

#### Instructions Manual

#### Descriptions in this manual on safety matters:

This product must be operated and used properly.

Otherwise, or when it is operated and used erroneously, unforeseen accidents may occur, causing physical injuries or property damages. Majority of these accidents can be avoided if you are well informed of hazardous circumstances in advance.

Consequently, this instructions manual describes all the hazardous and dangerous circumstances and situations which can be foreseen and anticipated as well as necessary precautions.

All the above descriptions are being titled by the following symbol-marks and signal-words, namely:



Represents warnings ignorance of which can cause accidents involving fatal or serious physical injuries.



Represents cautions ignorance of which can cause accidents involving minor physical injuries or property damages.

#### Introduction

## Descriptions in this manual on safety matters:

# 1. Safety

## CONTENTS

1-1.	Safety Precautions		6
1–2.	Safety Information	for Handling	7

#### 2. Overview

2-1.	Characteristics	10
2–2.	Product Configuration	10
2–3.	Appearance	10

## 3. Name and Function of Each Section

3-1.	Signal I/O Connector (J1)	11
3–2.	DC Input/Motor Output Connector (J2, J3)	12
3–3.	POWER LED	12
3–4.	0. H. A LED	12
3–5.	Operating Section	13

## 4. Function Set-up by Use

4-1.	Setting	MOTOR SELECT switch	14
4-2.	Setting	STEP ANGLE SELECT switch	14
4–3.	Setting	HOLD CURRENT ADJUSTMENT trimmer	15
4-4.	Setting	DRIVE CURRENT SELECT switch	16
4–5.	Setting	HOLD SWITCHING TIME SELECT switch	17
4–6.	Setting	Option switch	17

## 5. Installation

5-1.	Conditions for I	nstallation	 18
5-2.	Mounting Method		 19

## 6. Connection

6-1.	Overview of Connection Configuration	20
6–2.	Connecting Signal 1/0 Connector (J1)	21
6–3.	Connecting DC Input/Motor Output Connector (J2, J3)	22
6-4.	Inputting Power	23

## 7. Confirmation of Setting and Connection

7-1.	Check Points		24
------	--------------	--	----

	I	PAGE
8. Maintenance and Check-up	0	
		25 26
9. Storing and Disposal		
9-1. Storing		27
9-2. Disposal		27
1 O. Specifications		
10-1. General Specifications 10-2. I/O Signal		28
		29
(2) Drive pulse input	(CW, CCW)	
(3) Motor excitation stop input	(M. F)	31
(4) Phase signal output	(P. 0)	32
(5) Overheat alarm signal output	(0. H. A)	33
(6) Step angle switch input	(C. S)	34
10-4. Applicable Motors		36
10-5. Torque Characteristics		37

# 1. Safety

- 1 1. Safety Precautions
  - (1) This product is not designed or manufactured for application for equipment requiring high level of reliability such as equipment related to nuclear energy, aeronautics-related equipment, automobiles, ships, medical appliances directly handling the human body and equipment that might seriously affect properties.
  - (2) This product is for a devices inclusion.
     Please establish it into enclosure without fail.
  - (3) Ensure to use this product according to the method specified in the Instructions Manual and within the specifications.
  - (4) Depending on the operational conditions, the stepping motor may step out when it is on holding-state or driving-state. In particular, the load in transport may fall if the motor steps out on the vertical drive (such as the Z-axis). Start operation after test run for deliberate confirmation of operation.
  - (5) The stepping motor may attain high temperature, depending on the operational conditions.
     If the surface temperature exceeds 100°C, provide cooling measures to control it to operate at 100°C at the highest.
  - (6) Please do not touch the driver during after operation for a while, may cause burn on the skin due to overheating of the driver.
  - (7) Provide fail-safe measures so that the entire system may operate in a safe mode even in cases of the external power supply failure, disconnection of the signal line, or any failure on the driver.

## 1-2. Safety Information for Handling

●0verall:

## ▲ CAUTION

Please do not touch the driver during after operation for a while, it may cause burn on the skin due to overheating of the driver.

●When setting up the MOTOR SELECT switch:

## 

Erroneous setting may cause burn on the skin due to overheating of the motor. Ensure correct setting.

●When setting up the STEP ANGLE SELECT switch:

# 

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of the motor. Ensure correct setting.

●When setting up the HOLD CURRENT ADJUSTMENT trimmer:

## 

A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

•When setting up the DRIVE CURRENT SELECT switch:

## ▲ CAUTION

Erroneous setting may cause burn on the skin due to overheating of the motor. Ensure correct setting. ●When installing:

A WARNING

Overheating may cause fire. Mount it on a noncombustible member. Keep it away from combustibles.

●When connecting the DC Input/Motor Output Connectors (J2, J3):

## A CAUTION

Erroneous connection may result in breakage of the motor. Correctly connect the motor wiring.

•When inputting power:

Breakage of the machine or injury is apprehended due to unexpected behavior of the motor. Maintain the state where emergency stop is enabled at any time.

•When performing maintenance and checking:

## **A**WARNING

Injury or fire is apprehended due to unexpected behavior. Do not replace fuse. Do not disassemble, repair or modify.

●When inputting the motor excitation stop (M.F) signal:

## 

Deterioration of the holding power with the motor may cause breakage of machine or injury. Check safety before inputting.  $\blacksquare$  When the overheat alarm (O.H.A) signal is output:

## **A**WARNING

Overheating may cause fire. Stop operation upon output of this signal.

## 2. Overview


2-1. Characteristics

GDB-5411A-00 is a driver for a 5-phase stepping motor with DC +24V input. It can drive a 5-phase stepping motor ranging from 0.75A/phase  $\sim$  1.4A/phase. Ten step angles can be selected from angles ranging from a 1/1 division to a 1/800 division of the basic angle. HOLD CURRENT and DRIVE CURRENT can be set up.

#### 2-2. Product Configuration

The product consists of the main frame and the accessories.


●GDB-5411A-00	One unit	
●Housing for J1(51103-1200:Molex)	One unit	(accessory)
●Housing for J2(51067-0200:Molex)	One unit	(accessory)
●Housing for J3(51067-0500:Molex)	One unit	(accessory)
• Contact for J1 (50351-8100:Molex)	14 contacts	(accessories,2 for spares)
●Contact for J2,J3 (50217-9101:Molex)	9 contacts	(accessories,2 for spares)

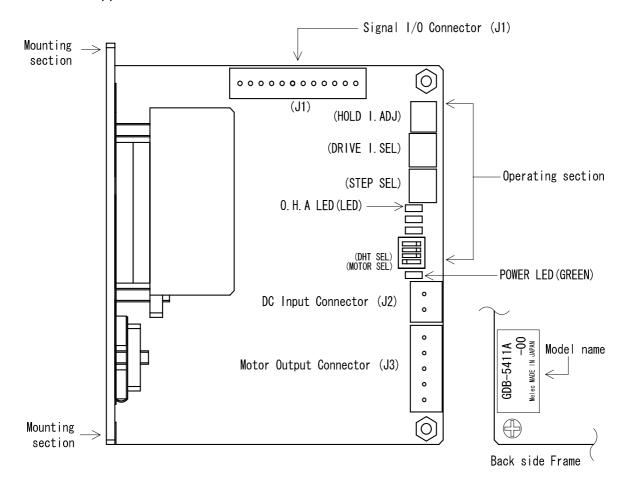


#### 2-3. Appearance

# 3. Name and Function of Each Section

3-1. Signal I/O Connector (J 1)

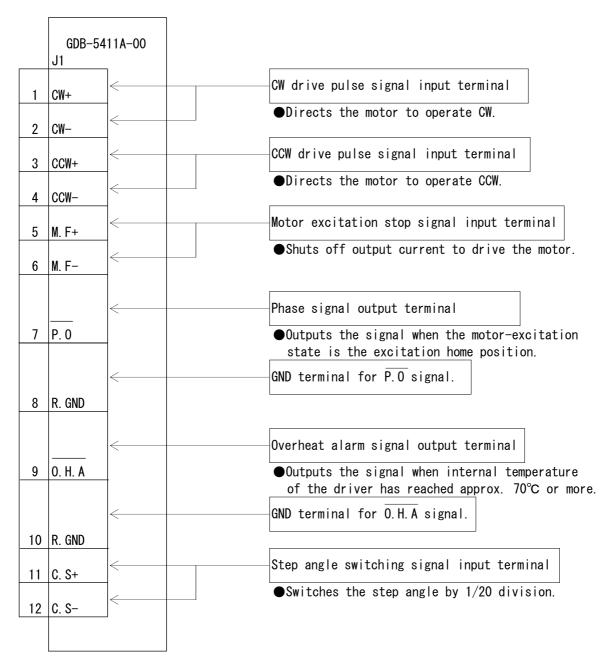

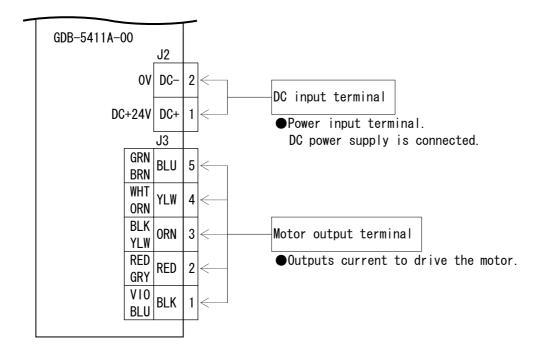


#### 3-2. DC Input/Motor Output Connector (J 2, J 3)


#### 3-3. POWER LED

POWER LED(GREEN) comes on upon inputting power.

#### 3-4. O.H.A LED

 0. H. A LED (RED) comes on when internal temperature of the driver has reached approx.  $70^{\circ}C$  or more.



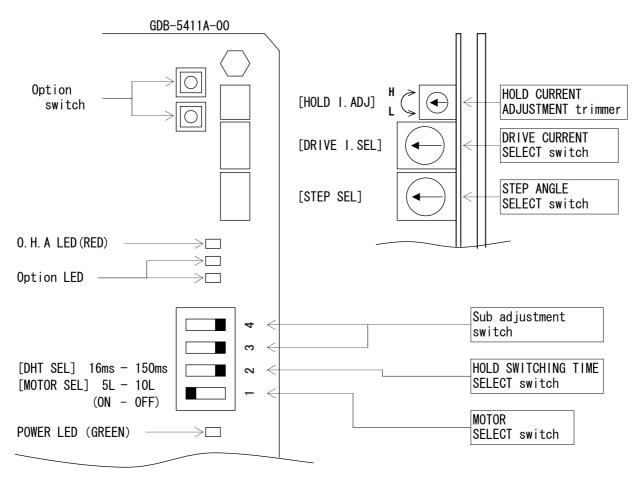

Name of Operation Section	Function	Factory Setting
Option switch (Option LED)	At present there is not a function.	_
HOLD CURRENT ADJUSTMENT trimmer	Adjusts HOLD CURRENT.	[40%]
DRIVE CURRENT SELECT switch	Selects DRIVE CURRENT.	[No.F]
STEP ANGLE SELECT switch	Selects a step angle.	[No.1]
Sub adjustment switch	Please use it with OFF.	(0FF)
HOLD SWITCHING TIME SELECT switch	DRIVE/HOLD CURRENT automatic switching time is selected.	[150ms]
MOTOR SELECT switch	Selects the applicable motor.	[10L]

## 4. Function Set-up by Use

4-1. Setting MOTOR SELECT switch

AUTION

Erroneous setting may cause burn on the skin due to overheating of the motor. Ensure correct setting.

The MOTOR SEL switch is turned to the setting corresponding to the motor in use. Set this switch with power OFF. The switch is factory-set to [10L].

- (1) Turn power [OFF].
- (2) Turn switch1 [10L/5L] to the setting specified in the table "10-4. Applicable Motors."
- 4-2. Setting STEP ANGLE SELECT switch

## 

Erroneous setting may cause breakage of the machine or injury due to unexpected rotation of motor. Ensure correct setting.

The step angle is set up with the STEP SEL switch. The step angle can be selected from ten different types of step angles. The switch is factory-set to [No. 1].

(2) Set the switch No. to the step angle required.

igodotRelationship between the STEP SEL switch No. and the step angle.

Switch No.	Number of Divisions	Step angle(°) 0.72° motor	
0	1/1	0. 72	
1	1/2	0.36	(Factory setting)
2	1/4	0. 18	]
3	1/10	0. 072	]
4	1/20	0. 036	
5	1/40	0. 018	
6	1/100	0.0072	
7	1/200	0.0036	]
8	1/400	0. 0018	]
9	1/800	0.0009	

•Drive with two types of step angles are provided by combining the STEP SEL switch setting and the C.S signal.

4-3. Setting HOLD CURRENT ADJUSTMENT trimmer

R1


A high setting value may cause burn on the skin due to overheating of the motor. Do not select a high value beyond the required.

HOLD CURRENT is set up with the HOLD I. ADJ trimmer. This sets the ratio of HOLD CURRENT to DRIVE CURRENT. The trimmer is factory-set to approx. 40%.

(1) Set the gauge of the trimmer to the required value.

•Relationship between the trimmer scales and HOLD CURRENT.

Ratio of HOLD CURRENT (%) =  $\frac{\text{HOLD CURRENT}}{\text{DRIVE CURRENT}} \times 100$ 

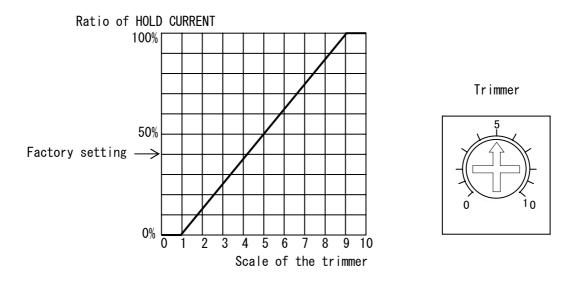

- HOLD CURRENT changes relative to DRIVE CURRENT setting. The ratio of HOLD CURRENT of 100% represents the same as the setting for DRIVE CURRENT.
- The greater the ratio of HOLD CURRENT grows, the more heat the motor generates when is on holding-state.
- When the trimmer is set minimum, HOLD CURRENT is approx. 10% or less of DRIVE CURRENT.

#### 4-4. Setting DRIVE CURRENT SELECT switch

AUTION

Erroneous setting may cause burn on the skin due to overheating of the motor. Ensure correct setting.

DRIVE CURRENT is set up with the DRIVE I.SEL switch. The switch is factory-set to [No.F].

(1) Set the switch No. to the setting specified in the table "10-4. Applicable Motors."

•Relationship between the DRIVE I.SEL switch and DRIVE CURRENT.

MOTOR SEL	switch		
switch1:(	N		
[5L]settir	ıg		
switch No.	A/phase		
0	0. 17		
1	0. 20		
2	0. 24		
3	0. 27		
4	0. 31		
5	0.34		
6	0.37		
7	0. 41		
8	0. 44		
9	0. 48		
А	0. 51		
В	0. 54		
С	0. 58		
D	0. 61		
E	0. 64		
F	0. 68	(Factory	setting)

	MOTOR SEL	switch			
	switch1:(	)FF			
	[10L]setti	ng			
	switch No.	A/phase			
	0	0.34			
	1	0.40			
	2	0. 47			
	3	0. 54			
	4	0. 61			
	5	0.67			
	6	0. 74			
	7	0. 81			
	8	0.88			
	9	0.95			
	А	1.01			
	В	1.08			
	С	1.15			
	D	1. 21			
	E	1. 28			
)	F	1.35			

(Factory setting)

## 4-5. Setting HOLD SWITCHING TIME SELECT switch

DRIVE/HOLD CURRENT automatic switching time is set up with the HOLD SWITCHING TIME SELECT switch. The switch is factory-set to [150ms].

(1) Set the switch 2 [150 ms/16 ms].

switch2	Hold Switching Time
ON	16ms
0FF	150ms

## 4-6. Setting Option switch

At present there is not a function.


## 5. Installation

#### 5-1. Conditions for Installation

	Overheating may cause fire. Mount it on a noncombustible member. Keep it away from combustibles.
(1)	Designed for incorporating into equipment used indoors, this product requires to be installed in the following environment:
	<ul> <li>Indoors (where it is not exposed to direct sun).</li> <li>Where ambient temperature and humidity are controlled within the range set out in the specifications.</li> <li>Where there is no corrosive or inflammable gas.</li> <li>Where it can be protected from dust, salt or iron powder.</li> </ul>

•Where it is not exposed to splashes of water, oil or chemicals.

(2) Install the driver at least 15mm away from other equipment.

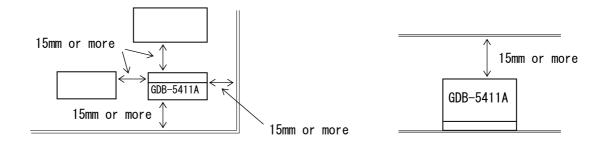

- (3) Considering heat release, control the ambient temperature around the driver within the specified value.
  - Take measures against accumulation of heat such as allowing generous space around the driver or installing a fan so that heat release is taken care of.
  - Install the driver securely in contact with metal or other substance with adequate heat conductivity.
- (4) In the case that an overheat alarm signal is output, perform the cooling measure of the mounting plate is enlarged or compulsion air cooling etc.
   Use the driver on the condition that an overheat alarm signal is not output.
- (5) Do not allow standing or placing anything heavy on the product.


5-2. Mounting Method

The round holes on the main body are used.

The following items are required: ●M-3 screw (8mm or more in length): 2 ●M-3 spring washer: 2 ●M-3 flat washer: 2


(1) Fix the product at the two round holes on the main body.

●Mounting example

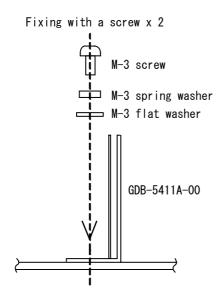

## 6. Connection

## 6-1. Overview of Connection Configuration

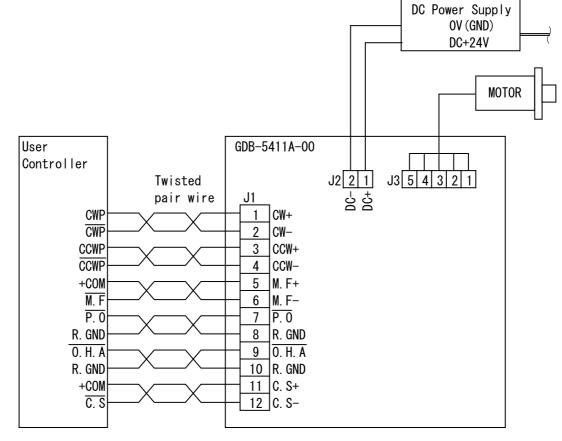

•Connect only one motor to one driver.

ullet Do not power ON/OFF by the relay etc. in the output side of the DC power supply.

●Use twisted pair wire for the CW/CCW input signal line.

•Provide shielding for the signal line where considerable noise is generated.


•Use the wire material of the characteristic that is difficult to burn.

•Provide shielding for the motor line if it generates significant noise.

•Use the DC power supply that was reinforced insulation between primary-side and secondary-side.

[Example configuration]

The metallic enclosure and shielded wires work to shield noise.

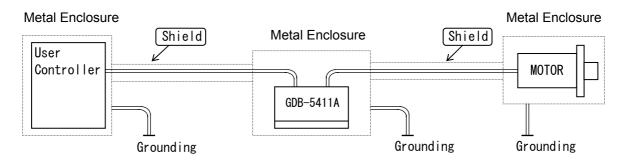



6-2. Connecting Signal I/O Connector (J 1)

The following items are required:

●Housing for J1(51103-1200:Molex)	One unit (accessory)
●Contact for J1 (50351-8100:Molex)	12 contacts (accessories)
●Manually operated crimping tool	One unit
for AWG28-22(57295-5000:Molex)	

 - (1) Crimp the contact to the cable used for wiring.
- (2) Insert the contact into the housing. Make sure that the housing No. and the connector No. on the main frame are matched before inserting the contacts.
- (3) Connect the housings to the connectors on the main frame.
  - •The contacts for J1 are 12 pieces.
  - •When inserting, keep pushing J1 housing into the connector until it is locked. Also, check if the contacts are not displaced from the housing.
  - In wiring, isolate the J1 signal lines from equipment that may be a source of noise, the power line and the motor line.



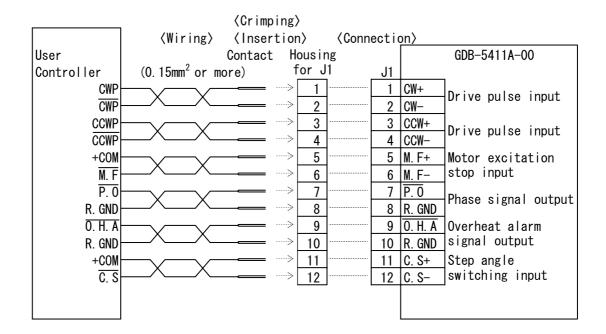

6-3. Connecting DC Input/Motor Output Connector (J 2, J 3)

A CAUTION

 
Erroneous connection may result in breakage of the motor. Correctly connect the motor wiring.

The following items are required:


 Housing for J2 (51067-0200:Molex)
 Housing for J3 (51067-0500:Molex)
 Contact for J2, J3 (50217-9101:Molex)
 Manually operated crimping tool for AWG24-18 (57189-5000:Molex)
 One unit (accessory) One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)
 One unit (accessory)

- (1) Crimp the contact to the cable used for wiring.
- (2) Insert the contact into the housing. Make sure that the housing No. and the connector No. on the main frame are matched before inserting the contacts.
- (3) Connect the housings to the connectors on the main frame.
  - The contacts for J2(for DC input) are 2 pieces, and for J3(motor output) are 5 pieces.
  - When inserting, keep pushing J2, J3 housings into the connectors until it is locked. Also, check if the contacts are not displaced from the housing.


(Surface on which the contacts are inserted)



[DC input Connector]

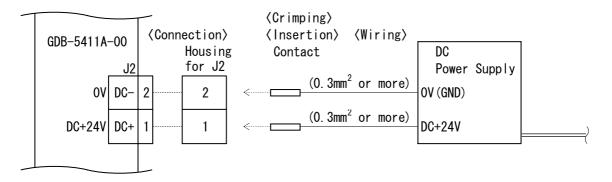

●Do not power ON/OFF by the relay etc. in the output side of the DC power supply.

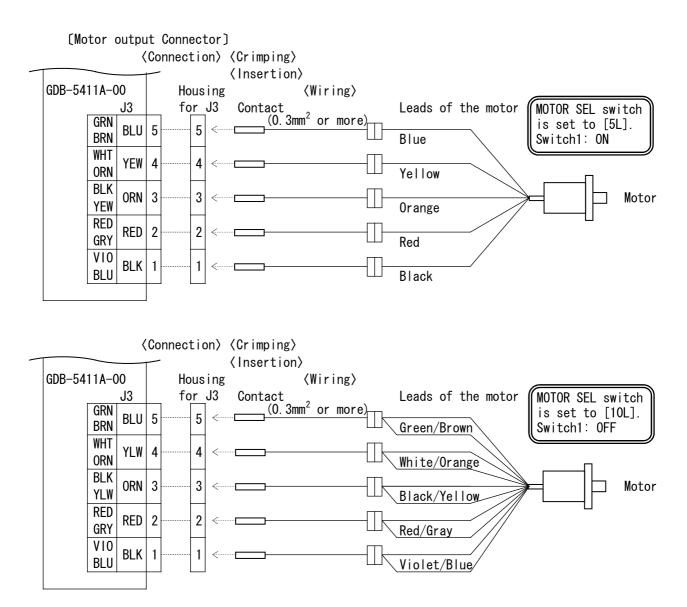

●Color indications for the motor crimping J3 represent colors of the leads of the motor.

#### 6-4. Inputting Power

Breakage of the machine or injury is apprehended due to unexpected behavior of the motor. Maintain the state where emergency stop is enabled at any time.

(1) Input the DC power supply (DC+24V) in the cable that connected to No.1 and No. 2 terminals of J2.

# 7. Confirmation of Setting and Connection

#### 7-1. Check Points

This product requires different switch setting and motor wiring depending on the motor used.

Check if the switch setting and the motor wiring are correctly performed.

Check Points		Check	Remarks
Setting of STEP ANGLE SELECT switch	Switch No.		
Setting of HOLD CURRENT ADJUSTMENT trimmer	Trimmer Scale		
Setting of DRIVE CURRENT SELECT switch	Switch No.		
Setting of MOTOR SELECT switch	Switch1: 10L/5L		
Setting of HOLD SWITCHING TIME SELECT switch	Switch2: 150ms/16ms		
Connection of J1			
Connection of J2	DC+, DC-		
Connection of J3			

## 8. Maintenance and Check-up

#### 8-1. Maintenance and Check-up

#### **A**WARNING

Injury or fire is apprehended due to unexpected behavior. Do not replace fuse. Do not disassemble, repair or modify.

- (1) As for a maintenance inspection the engineer of the speciality shall do it.
- (2) We recommend that the following check-ups should be performed periodically:
  Checking for any loosened contact on the connectors.
  Checking for any flaw and crack on the cabling.
- (3) In case of failure, return the driver to us and have it repaired.

## 8-2. Troubleshooting

Trouble	Check Item	Assumed Cause
1. POWER LED does not come on.	<ul> <li>Connection of power supply.</li> <li>Value of power voltage.</li> </ul>	<ul> <li>Wiring error with power supply.</li> <li>Power voltage failure.</li> <li>Driver failure.</li> </ul>
2. The motor is not excited. (It can be easily rotated by hand.)	<ul> <li>Connection of the motor to the driver.</li> <li>ON/OFF status of the M.F signal.</li> <li>Value of the HOLD CURRENT ADJUSTMENT trimmer.</li> </ul>	<ul> <li>Wiring error with the motor and the driver.</li> <li>The M.F signal is input.</li> <li>HOLD CURRENT is set to zero.</li> <li>Driver failure.</li> </ul>
3. The motor does not rotate. The motor behaves abnormally. The motor steps out.	<ul> <li>The same check items as those under item 2 above.</li> <li>Setting of the MOTOR SELECT switch.</li> <li>Connection of the pulse signal.</li> <li>Voltage and wave form of the pulse signal.</li> <li>Setting of the DRIVE CURRENT SELECT switch.</li> <li>Setting of the STEP ANGLE SELECT switch.</li> <li>ON/OFF status of the C.S signal.</li> </ul>	<ul> <li>Wrong setting for the motor selection.</li> <li>Wiring error with the pulse signal line.</li> <li>Pulse signal of wrong specifications.</li> <li>DRIVE CURRENT is too low.</li> <li>Wrong setting for the step angle.</li> <li>The C.S signal is input.</li> <li>Driver failure.</li> <li>Motor failure.</li> </ul>
4. The motor steps out during acceleration.	<ul> <li>Starting pulse speed.</li> <li>Acceleration time.</li> </ul>	<ul> <li>Starting pulse signal speed is too high.</li> <li>Acceleration time is too short.</li> </ul>
5. The motor generates excessive heat.	<ul> <li>Setting of the DRIVE CURRENT SELECT switch.</li> <li>Value of the HOLD CURRENT ADJUSTMENT trimmer.</li> <li>Setting of the MOTOR SELECT switch.</li> </ul>	<ul> <li>DRIVE CURRENT is higher than the setting for the applicable motor.</li> <li>The setting for HOLD CURRENT is too high.</li> <li>Wrong setting for the motor selection.</li> </ul>

Short-circuiting of the motor output connector may cause the driver to fail.

•The motor output connector and the power line.

 $\bullet \mbox{The motor output connector}$  and the motor output connector.

When the failure phenomenon cannot be remedied, contact our office.

# 9. Storing and Disposal

#### 9-1. Storing

(1) Keep the product in the following environment:

Indoors (where it is not exposed to direct sun).
Where ambient temperature and humidity are controlled within the range set out in the specifications.
Where there is no corrosive or inflammable gas.
Where it can be protected from dust, salt or iron powder.
Where the product main frame is not exposed to direct vibration or shock.

- •Where it is not exposed to splashes of water, oil or chemicals.
- (2) Do not allow standing or placing anything heavy on the product.

#### 9-2. Disposal

(1) Dispose of the product as industrial waste.

# 1 O. Specifications

## 1 O - 1. General Specifications

Supply Power	DC+24V *1 (Ripple voltage Rated input current :P-P 2.0V or less) $ullet$ Rated input current :[DRIVE I. SEL $\Rightarrow$ No. F set up]at DRIVEDC+24V: 2.0A *2 $ullet$ Rated input current :[HOLD I. ADJ $\Rightarrow$ Approx. 40% set up]at HOLDDC+24V: 0.4A						
Motor output	MOTOR SEL switch is set to [5L] ODRIVE CURRENT 0.17A/phase~0.68A/phase HOLD CURRENT Approx. 40% of DRIVE CURRENT (factory-set)						
current	MOTOR SEL switch is set to [10L]•DRIVE CURRENT •HOLD CURRENT0. 34A/phase ~1. 35A/phase Approx. 40% of DRIVE CURRENT (factory-set)						
Input Signal	Orive pulse input(CW, CCW)Photo-coupler inputMotor excitation stop input(M. F)Photo-coupler inputStep angle switch input(C. S)Photo-coupler input						
Output Signal	•Phase signal output(P. 0)0/C output•Overheat alarm output(O. H. A)0/C output						
Functions of Operating Sections	<ul> <li>Motor selection</li> <li>HOLD CURRENT adjustment</li> <li>HOLD CURRENT selection</li> <li>Step angle selection</li> <li>HOLD switching time selection</li> <li>(DRIVE LSEL)</li> </ul>						
Operating Ambient Temperature	0°C ∼ +40°C (No freezing allowed.)						
Operating Ambient Humidity	80%RH or less (No condensation allowed.)						
Storing Temperature	-10°C ~ +55°C (No freezing allowed.)						
Storing Humidity	80%RH or less (No condensation allowed.)						
Atmosphere	Indoor (Exposure to direct sun is not allowed.) Without any corrosive or inflammable gas, oil mist, or dust.						
Withstanding Vibration	No abnormality should be found after a vibration test at 10~55Hz, 0.15mm P-P						
Insulation resistance	DC connector - signal connector - Frame (Each other) DC500V 100MΩ or more						
Exterior Dimensions	$^{H}80 \times ^{W}90 \times ^{D}32 \text{ (mm)}$						
Weight	0.2 kg						


\*1 Input voltage range is DC+24V $\pm$ 10%.

\*2 Use a power supply that provides sufficient input current.


-28-


## 1 0 - 2. I/O Signal


#### (1) Example Circuit Connection

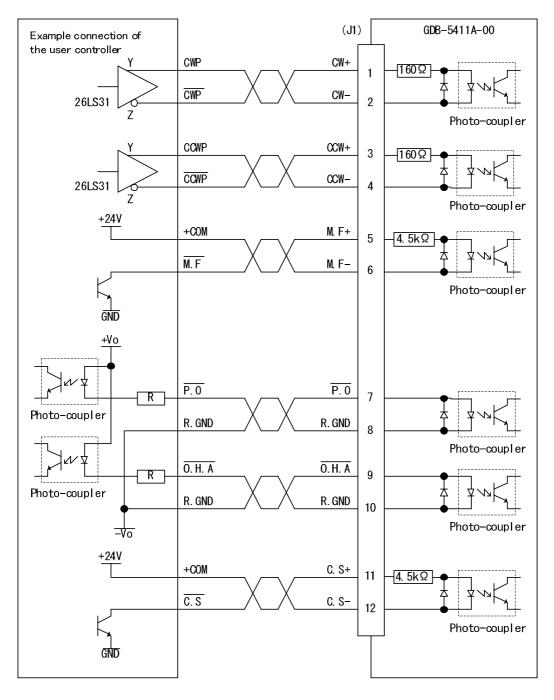

 - (2) Drive pulse input (CW, CCW)
- (1) Operating current range :  $9mA \sim 27mA$ The photo-coupler turns on with inter-terminal voltage of 3.1 V~5.5 V. (Photo-coupler diode V<sub>F</sub>  $\rightleftharpoons$  1.6 V)
- ② Timing chart

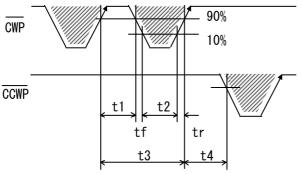

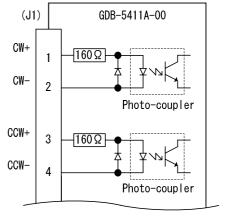





 $t1 \ge 0.5 \mu s$ ,  $t2 \ge 0.5 \mu s$ ,  $tf, tr \le 1 \mu s$  $t3 > 1 \mu s$ ,  $t4 > 1 \mu s$ 

Maximum response frequency : 1MHz

- The shaded area ( ) indicates light emission from the photo-coupler, and the motor is driven at the rising edge ( ).
   "t4" greatly varies according to the inertial moment including that of the motor.
- 3 Automatic switching for DRIVE/HOLD

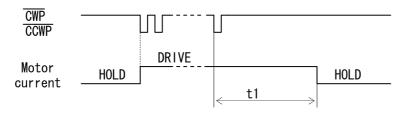


- t1 $\doteqdot$  16ms (HOLD SWITCHING TIME SELECT switch : ON ) t1 $\doteqdot$  150ms (HOLD SWITCHING TIME SELECT switch : OFF)
- Inputting drive pulse causes the current output to the motor to change from HOLD CURRENT to DRIVE CURRENT, which returns to HOLD CURRENT in about "t1". DRIVE CURRENT continues if pulse is input on driving-state.
- (4) Direction of rotation

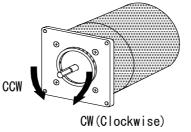

```
(3) Motor excitation stop input (M.F)
```

ACAUTION Deterioration of the holding power with the motor may cause breakage of the machine or injury. Check safety before inputting.

(1) Operating current range :  $4mA \sim 5.3mA$ The photo-coupler turns on with inter-terminal voltage of 19.1 V~25.1 V. (Photo-coupler diode V<sub>F</sub> = 1.1 V)

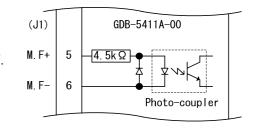


 Motor output current is shut off with the photo-coupler ON. At this time, motor torque changes to detent torque.

• When this signal is input, motor torque may be lost, resulting in failure to retain the load transported.


In particular, this risk is high with the vertical drive (such as the Z-axis).

2 Timing chart

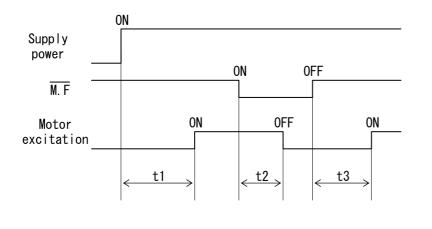

 $\begin{array}{lll} t1 \leqq 300 \text{ms} & (t1: \text{Time required for the motor to be enabled.}) \\ t2 \leqq 5 \text{ms} & (t2: \text{Time required for the motor output current to be shut off.}) \\ t3 \leqq 100 \text{ms} & (t3: \text{Time required for the motor to be enabled.}) \end{array}$ 


- (4) Phase signal output (P.O)
  - (1) Output current a.  $IC \leq 6mA$ , VCE(sat) < 5Vb.  $IC \leq 2mA$ ,  $VCE(sat) \leq 0.6V$  $VCEO \leq 30V$

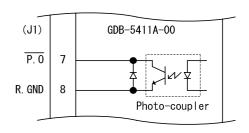

- In case of the excitation home position, the signal is output. (photo-coupler ON)
- In case of simultaneously using P.O signal and C.S signal, input C.S signal while P.O signal is being output to switch the step angle. Otherwise, P.O signal may not be output.

#### 2 Timing chart

• P.O output timing (for 1/1 STEP)

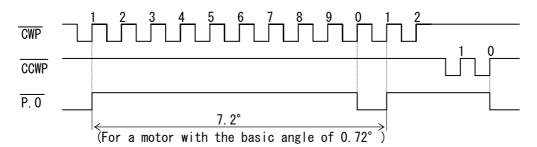

● P.0 output time


1/1 STEP:	once	in	10	pulses	1/4	) STEP:	once	in	400	pulses
1/2 STEP:	once	in	20	pulses	1/10	) STEP:	once	in	1000	pulses
1/4 STEP:	once	in	40	pulses	1/20	) STEP:	once	in	2000	pulses
1/10 STEP:	once	in	100	pulses	1/40	) STEP:	once	in	4000	pulses
1/20 STEP:	once	in	200	pulses	1/80	) STEP:	once	in	8000	pulses

(5) Overheat alarm signal output (O.H.A)

WARNING Overheating may cause fire. Stop operation upon output of this signal.

- Please use overheat alarm signal output (O.H.A) without fail.
- In case of internal temperature of the driver reaches approx. 70°C or more, the signal is output (photo-coupler ON) and O. H. A LED comes on. At this time the motor output current is not blocked.
- When this signal is output, stop operation and check if there is any abnormality occurring with the motor and the driver.
- Provide mechanical cooling, for example, if this signal is output while no abnormality is detected.
- Continuous operation is possible unless this signal is output.

 
- (6) Step angle switch input (C.S)
- ① Operating current range : 4.0mA~5.3mA The photo-coupler turns on with inter-terminal voltage of 19.1 V~25.1 V. (Photo-coupler diode V<sub>F</sub>≒ 1.1 V)



● Step angle division is switched to 1/20 divisions with the photo-coupler ON. The setting for the STEP ANGLE SELECT switch is ignored.

●No displacement occurs even if the step angle is switched by the C.S signal.

#### ② Timing chart

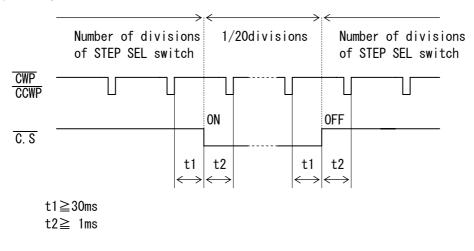

• Switching the step angle by the C.S signal requires time t1 and t2 before and after inputting drive pulse.

③ STEP ANGLE SELECT switch and C.S signal

Switch No.	Number of	Step angle(°)		
SWILCH NO.	Divisions	0.72° Motor		
0	1/1	0. 72		
1	1/2	0.36		
2	1/4	0. 18		
3	1/10	0. 072		
4	1/20	0. 036		
5	1/40	0.018		
6	1/100	0.0072		
7	1/200	0. 0036		
8	1/400	0. 0018		
9	1/800	0. 0009		

[STEP ANGLE SELECT switch]


(When the C.S signal is input)



1/20 divisions (0.036°)

## 1 O - 3. Dimensions

(Unit:mm)

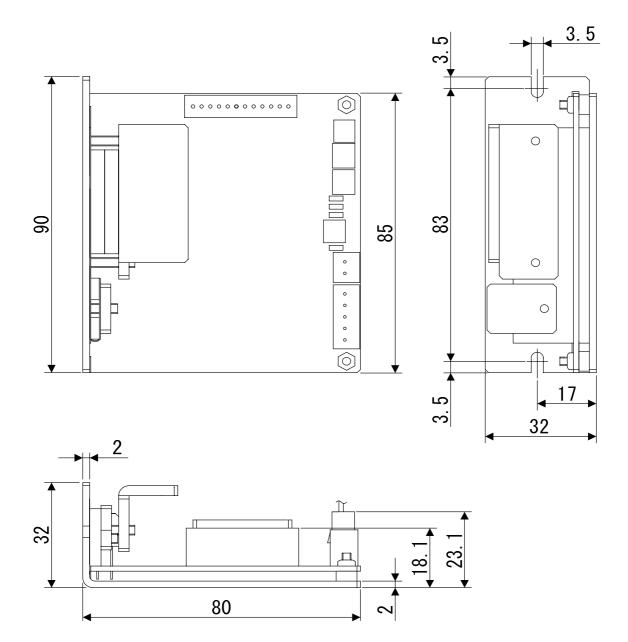

## 1 O - 4. Applicable Motors

●5-phase	stepping	motors	of	following	table.	

Applicable Motors	Basic Angle (°)	Current (A/phase)	Setting DRIVE I.SEL switch No.	MOT( sw	tting DR SEL vitch itch1	Torque Data Fig. No.
Sanyo Denki Co., Ltd. 103H5505-7040 (7010) 103H5508-7040 (7010) 103H5510-7040 (7010)	0. 72	0. 75	F	ON	(5L)	Fig. 1 Fig. 2 Fig. 3
103H6500-7041 (7011) 103H6501-7041 (7011)	0. 72	0. 75	F	ON	(5L)	Fig.4 Fig.5
103H7851-7051 (7021) 103H7852-7051 (7021) 103H7853-7051 (7021)	0. 72	0. 75	F	ON	(5L)	Fig.6 Fig.7 Fig.8
Oriental Motor Co., Ltd. PK543-A(B) PK544-A(B) PK545-A(B) PK564-A(B) PK566-A(B)	0. 72	0. 75	6	OFF	(10L)	Fig. 9 Fig. 10 Fig. 11 Fig. 12 Fig. 13
PK564H–A (B) PK566H–A (B) PK569–A (B)	0. 72	1.4	F	0FF	(10L)	Fig. 14 Fig. 15 Fig. 16
Factory Sett	F	0FF	(10L)	-		

( ) : Both axes

#### 1 O - 5. Torque Characteristics

(1) Representations in the torque characteristics table are made in terms of the motor rotation  $(s^{-1})$  vs. torque  $(N \cdot m)$ . Motor rotation  $(s^{-1})$  and drive pulse frequency (Hz) are converted as follows:

Motor rotation(s<sup>-1</sup>) ×  $\frac{360^{\circ}}{\text{Step angle}}$  = Drive pulse input frequency(Hz)

ullet Maximum value of the rotate speed is 60s  $^{-1}$  at 0.72  $^\circ\,$  motor.

- (2) The Maximum Starting Pulse Rate is represented as "fs" by the value at zero inertial load.
- (3) Upon operation, provide adequate allowance for torque.
- (4) The stepping motor may attain high temperature, depending on the operational conditions.
  - If the surface temperature exceeds 100°C, provide cooling measures to control it to operate at 100°C at the highest.

#### Instructions Manual

INPUT CURRENT (A)

fs

fs 1 ....

fs

10

10

10

INPUT CURRENT (A)

11115.0

4.0

2.0

₫1.0

100 (s<sup>-1</sup>)

∏5.0

4 0

**₩3. 0** 

<u></u>∦2. 0

**⋣**1. 0

100

(s<sup>-1</sup>)

<u>∭5.</u> 0

4.0


H3. 0


III 2. 0


Щ1. 0


100 (s<sup>-1</sup>)


INPUT CURRENT (A)

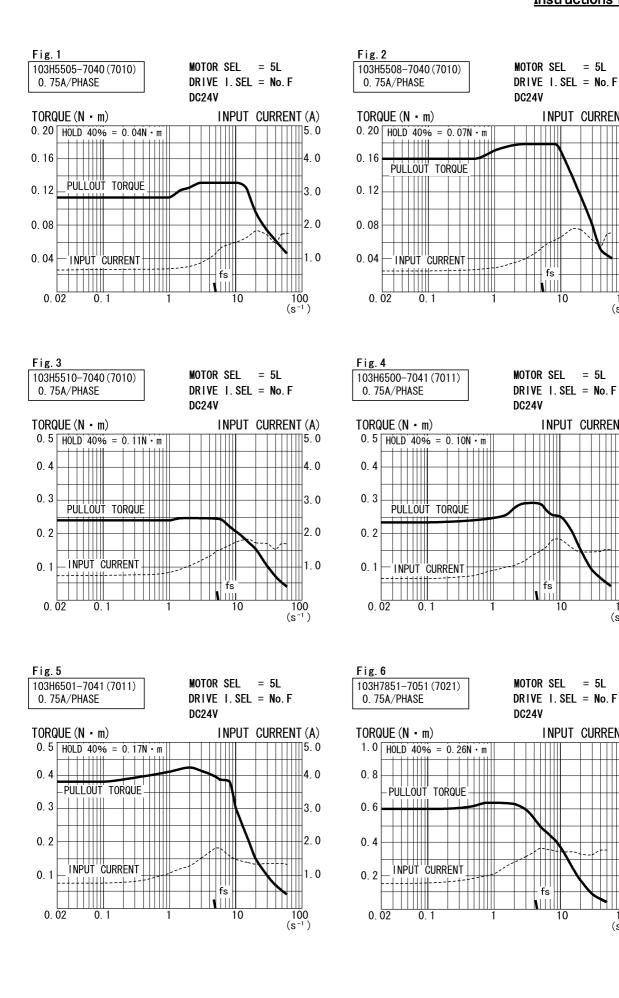


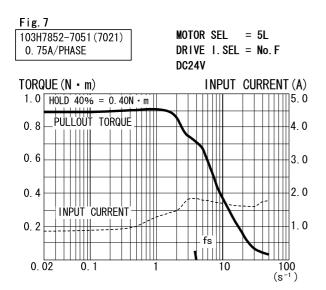

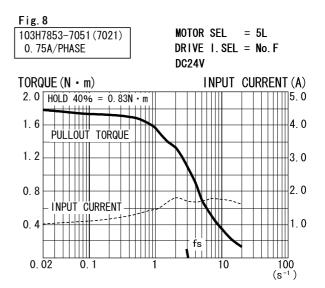

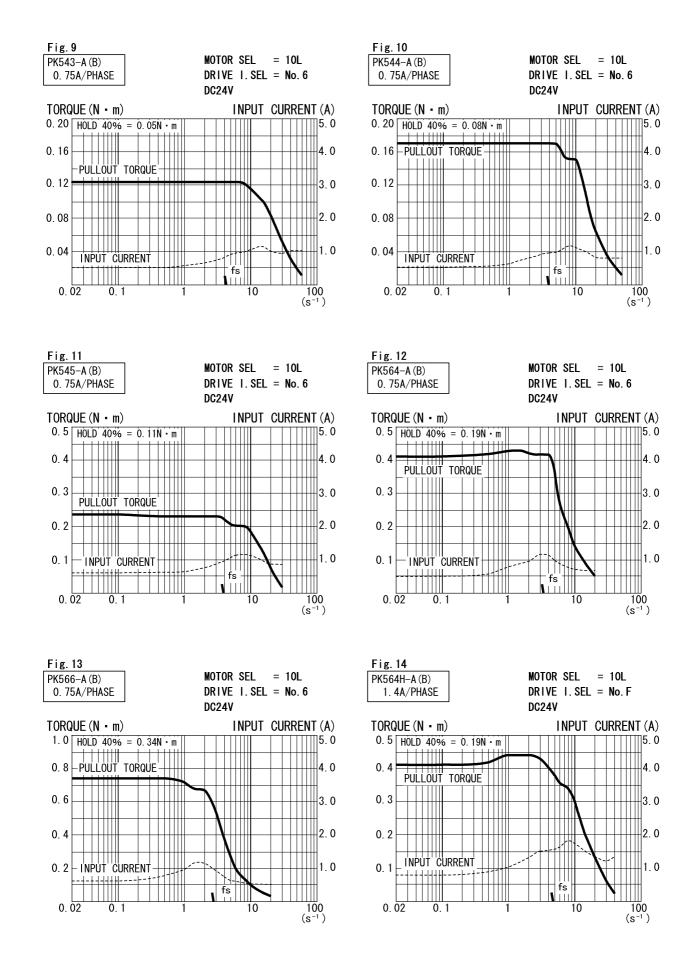

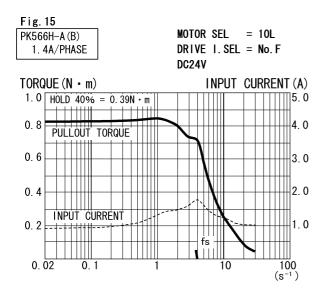

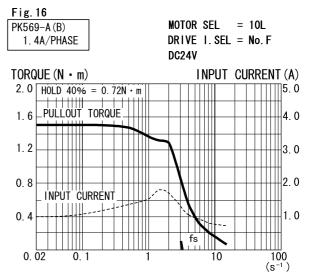

#### **Technical Service**

TEL. (042) 664-5382 FAX. (042) 666-5664 E-mail s-support@melec-inc.com

#### Sales and Service

TEL. (042) 664-5384 FAX. (042) 666-2031 URL:http://www.melec-inc.com

Melec Inc. Control equipment marketing department 516-10,Higashiasakawa-cho,Hachioji-shi,Tokyo 193-0834,Japan

This Operating Manual is subject to change without prior notice for the purpose of product improvement.